

Sensor Installation


- 1 Pull the battery tab to activate the sensor.



- 2 Ensure the mounting surface is clean.
- 3 Peel off the adhesive backing.



- 4 Mount the sensor at the desired location and apply light pressure for 2 seconds to ensure proper adhesion.
- ⊗ Sensor should be placed **at least 1 m (3ft)** from doors, windows, air supply, air vents or any other heating or cooling source that can affect the temperature or humidity measurement.

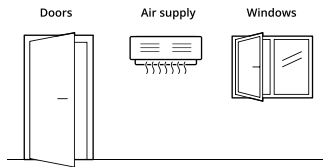


DISRUPTIVE
TECHNOLOGIES

For support and more information about our products, visit: d21s.com/support

Disruptive Technologies Research AS
Strandveien 17, 1366 Lysaker, Norway

TM and © Disruptive Technologies
Research AS. All rights reserved.

Designed and manufactured in Norway.

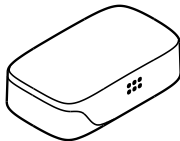

Safety & Use
Manual

